



P.O. Box 1160, St. Joseph, MO 64502-1160  
Phone: (800) 255-0317, Fax: (785) 989-3075

Product  
Safety  
Bulletin  
PSB-16.003

Date August 12, 2016


This Product Safety Bulletin must be read and understood by all Service Technicians who are trained and authorized to service the machines affected by this bulletin.

# SAFETY RELATED

Read and Fully understand this procedure before beginning. Follow instructions completely. Contact the Snorkel Service Department with questions or concerns about this procedure at 1-800-255-0317 or 785-9893000.

*This procedure only effects AB46JE, A46JE, AB46JRT and A46JRT machines.* The purpose for this SAFETY RELATED BULLETIN is to inspect and ensure the Slave Level Stepped Pins SOCKET HEAD CAPSCREW are torqued properly. Failure to comply with this SAFETY RELATED BULLETIN could result in DEATH or SERIOUS INJURY. This inspection should take approximately 1 hour. During the inspection process, if you determine the bolts are not properly torqued, please contact the Snorkel Service Department with the model, complete serial number and hour meter reading.

At lower controls, extend tip boom out approximately two to three feet. Using a Hex key remove the two SOCKET HD CAPSCREWS, .250-20 UNC STL 1.50 LG that secures stepped pin (s) to the slave level cylinder trunnion mount and tip boom. Inspect both socket head cap screws for abnormal wear and proper torque, record findings and report to Snorkel, as instructed above. Then replace the bolts with Snorkel P/N 978419, Qty. 4. Apply Loctite 242 P/N 8120071 to threads and reinsert socket head cap screws into stepped pin and lightly tighten. Using a torque wrench, torque each socket head cap screw to 12ft.lbs or (17Nm).

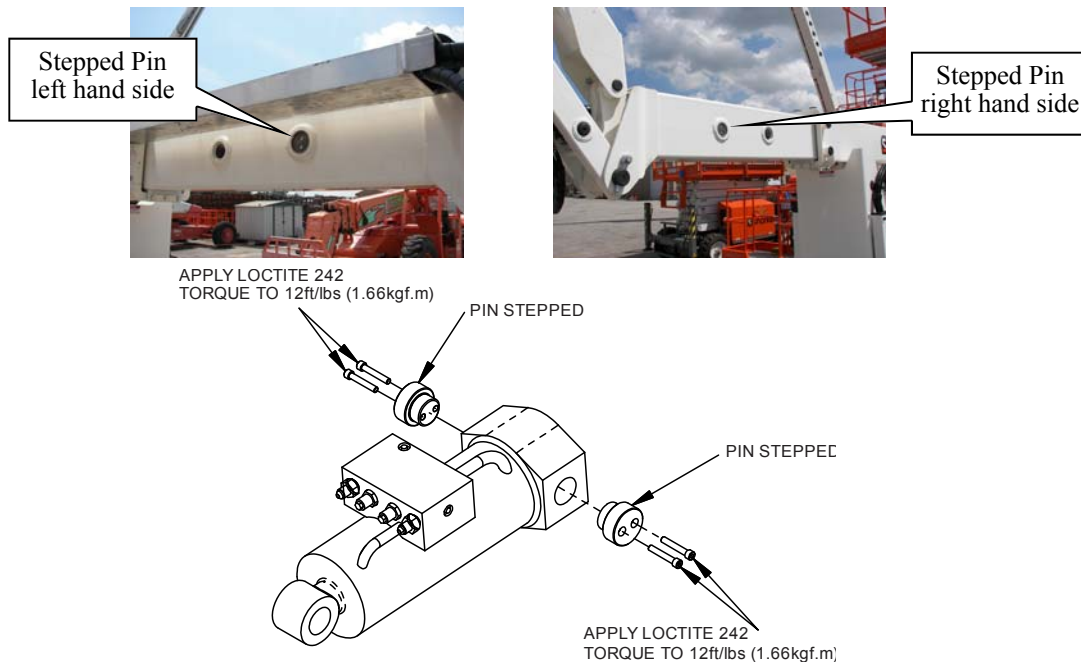



***For Further Information in North and South America***

Contact the Snorkel Service Department at:

Phone: 1-800-255-0317 or 1-785-989-3091

Fax: 1-785-989-3075

Or contact the Snorkel Service Department via email at:

[tony.deatherage@snorkellifts.com](mailto:tony.deatherage@snorkellifts.com)

[gary.wampler@snorkellifts.com](mailto:gary.wampler@snorkellifts.com)

[kevin.mccarter@snorkellifts.com](mailto:kevin.mccarter@snorkellifts.com)

[jerry.simmons@snorkellifts.com](mailto:jerry.simmons@snorkellifts.com)

[chuck.adkins@snorkellifts.com](mailto:chuck.adkins@snorkellifts.com)

[mike.koon@snorkellifts.com](mailto:mike.koon@snorkellifts.com)

[allan.kelly@snorkellifts.com](mailto:allan.kelly@snorkellifts.com)

***Further Information in EMEA***

Contact the Snorkel Service Department at:

Phone: +44 (0) 191 4616909 / +44 (0) 191 4616910

Or contact Technical Support via email at:

[neil.brown@snorkellifts.com](mailto:neil.brown@snorkellifts.com)

[mark.hutchinson@snorkellifts.com](mailto:mark.hutchinson@snorkellifts.com)

[brian.aitchinson@snorkellifts.com](mailto:brian.aitchinson@snorkellifts.com)

***For Further Information in Australia***

Contact the Snorkel Service Department at:

Phone: 1300 700 450

Or contact Technical Support via email at:

[bruce.maclean@snorkellifts.com.au](mailto:bruce.maclean@snorkellifts.com.au)

[kon.merkouris@snorkellifts.com.au](mailto:kon.merkouris@snorkellifts.com.au)

***For Further Information in Asia Pacific***

Contact the Snorkel Service Department at:

Phone: 03-5765-6841

Or contact Technical Support via email at:

Fun Fook Wai : [fw.fun@snorkellifts.com](mailto:fw.fun@snorkellifts.com)

***For Further Information in Asia (Japan)***

Contact the Snorkel Service Department at:

Phone: 03-5765-6841

Or contact Technical Support via email at:

[sakuma@snorkeljp.com](mailto:sakuma@snorkeljp.com)